



Chimney Inspection Checklist

AH-215594 / 20 Jun 2023

Complete

Score	90%	Flagged items	2	Actions	1
Site conducted					Unanswered
Service Number					AH-215594
Customer					Kevie Roms
Location				Estate Enighed, Independence, KS 67301, USA	
Conducted on (Date and Time)					20.06.2023 15:34 PST
Prepared by (Full Name)					Joe Lengco

Flagged items & Actions

2 flagged, 1 action

Flagged items

2 flagged, 1 action

Inspection / Inspection / Chimney

Height

Unsatisfactory

Loose chimney cap



Photo 1

To Do | Assignee Juhlian Pimping | Priority High | Due 21.06.2023 15:49 PST | Created by SafetyCulture Staff

Fix loose chimney cap

Inspection / Inspection / Chimney

Flashing

Unsatisfactory

Damaged flashing this needs repair



Photo 2

Other actions

0 actions

Inspection

2 flagged, 1 action, 90%

System Information

Fireplace

Construction

Masonry

Opening size

51" x 33"

Fuel

Wood

Heating appliance type

N/A

Chimney

Construction

Masonry

Height

16 ft

Liner

Flue tile

Size

13" x 13"

Last cleaning inspection

04.01.2022

Inspection

2 flagged, 1 action, 90%

Chimney

2 flagged, 1 action, 71.43%

Height

Unsatisfactory

Loose chimney cap



Photo 1

To Do | Assignee Juhlian Pimping | Priority High | Due 21.06.2023 15:49 PST | Created by SafetyCulture Staff


Fix loose chimney cap

Chimney Cap / Spark Arrestor

Satisfactory

Crown / Wash

Satisfactory

Brickwork / Mortar	Satisfactory
Flashing	Unsatisfactory
Damaged flashing this needs repair	
	
Photo 2	
Flue Liner	Satisfactory
Moisture Resistance	Satisfactory
Fireplace	100%
Smoke Chamber	Satisfactory
Damper	Satisfactory
Firebox / Grate	Satisfactory
Ash Container	Satisfactory
Spark Screen / Doors	Satisfactory
Tools / Gloves	Satisfactory
Heart Protection	Satisfactory
Stove or Fireplace Insert	100%
Connector Pipe Condition	Satisfactory
NFPA/IRC Approved Connection and Flue	Satisfactory
Installation / Thimble / Clearances	Satisfactory
Other Safety Considerations	100%
Fire Ext. / Smoke Detectors / CO Alarms	Satisfactory
Gas / Oil Furnace Flue Liner	Satisfactory
Fire Escape Plan	Satisfactory

Completion

Recommendations

The chimney cap is loose - It needs to be fixed
Chimney flashing needs repair and the chimney requires creosote cleaning.

Inspector (Full Name and Signature)



Joe Lengco
20.06.2023 15:48 PST

Media summary



Photo 1



Photo 2